









# DATA SHEET



# **KISTOCK Data logger** For HVAC - Temperature, Humidity



Configuration and data viewing software freely downloadable



Magnetic mounting

- Configuration and data processing software available as option
- 16,000 measurement points
- Measure up to 2 parameters
- 2 configurable setpoint alarms
- 1 line LCD display
- Fast data download (1000 values/second)
- IP65 (KT 50) and IP20 (KH 50) housing

#### **General features**

	KT 50	KH 50
Units displayed	°C, °F	°C, °F, % RH
Resolution	0.1 °C, 0.1 °F	0.1 °C, 0.1 °F, 0.1% RH
External inputs	Micro-USB connector	
Internal sensor	Temperature	Humidity, temperature
Setpoints alarm	2 setpoint alarms on each channel	
Frequency of measurement	From 1 minute to 24 hours	
Operating temperature*	From -40 to +70 °C	From -20 to +70 °C
Storage temperature	From -20 to +50 °C	
Battery life	500 days**	365 days**
European directives	2014/30/EU EMC; 2014/35/EU Low Voltage; 2011/65/EU RoHS II; 2012/19/EU WEEE	

<sup>\*</sup> The screen can be hard to read, and its display speed often slows down at temperatures lower than 0 °C. This has no effect on the accuracy of measurements. /

## **Technical specifications**

KT 50 Internal sensor	Temperature	
Type of sensor	NTC	
Measuring range	From -40 to +70 °C	
Accuracy*	$\pm 0.4$ °C from -20 to 70 °C $\pm 0.8$ °C below -20 °C	

## Housing

Dimensions	61.3 x 40 x 21.9 mm
Weight	40 g
Display	1 line LCD screen Screen dimensions: 26.5 x 22.5 mm
Control	1 OK key
Material	Compatible with food industry environment ABS housing Caps made of Elastomer
Protection rating	IP65: KT 50. IP20: KH 50
PC communication	1 micro USB input
Battery power supply	2 x CR2032 (lithium 3 V)
Environmental conditions of use	Hygrometry: in non-condensing condition Maximum altitude: 2000 m Air and neutral gases

KH 50 Thermo-hygrometer	Hygrometry	Temperature
Type of sensor	Capacitive	NTC
Measuring range	From 0 to 100% RH	From -20 to +70 °C
Accuracy*	±2.5% RH (from 15 °C to 25 °C, from 5 to 95% RH)**	±0.4 °C from 0 to 50 °C ±0.8 °C below 0 °C or above 50 °C

<sup>\*</sup> All accuracies indicated in this document were stated in laboratory conditions and can be guaranteed for measurements carried out in the same conditions, or carried out with calibration compensation.


<sup>\*\*</sup>Non-contractual value. Based on 1 measurement each 15 minutes at 25 °C. A correct operation of the device and the storage conditions must be respected.

<sup>\*\*</sup> Factory calibration uncertainty:  $\pm 0.88\%$  HR. Temperature dependence:  $\pm 0.04$  x (T-20) % HR (if T<15 °C or T>25 °C).

# Display MIN REC FULL END

°C: Temperature in degrees Celsius °F: Temperature in degrees Fahrenheit %RH: Relative humidity (KH 50)

### Dimensions (mm)

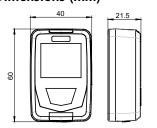

END Dataset is finished REC

Records the values at the moment when this indicator appears / flashing: the dataset has not yet started FULL Slow flashing: dataset is taking between 80 and 90% of storage capacity

Fast flashing: dataset is taking 90-100% of storage capacity

Constant: storage capacity filled up

MAX Displayed values correspond to maximum and minimum values of the channels MIN

Alarm action type: rising or falling action

Flashing on the screen + flashing of LEDs: means that the battery must be changed

## **Connections**

PC connection input



Micro-USB connector

## **EN12830 STANDARD**

KT 50 models dedicated to food industry, meet with requirements of EN 12830 norm. This certification is required for transportation, storage and distribution of refrigerated, frozen and deep-frozen food, and ice cream Certification is done by an independent laboratory, COFRAC accredited.

#### Calibration

KISTOCK data loggers can be supplied with an optional calibration certificate.

#### Recorder functions

The KISTOCK allows to record the values measured instantaneously, it records the values according to a predefined interval. On the other hand, it is possible to operate continuously the

KISTOCK thanks to a loop recording.

#### 3 types of dataset start

The measurement dataset can be launched:

- With a delayed start (with predefined date and time)
- With the software
- With push-button

## 6 types of dataset stop

You can stop your dataset:

- According to a date and time (if it was started the same way)
- According to a recording duration
- According to a predefined number of recording points
- If the storage capacity of the memory is full
- With "Stop" option of the software
- By holding "OK" key during about 5 seconds, if this function has been previously activated by the software.

#### Software

Freely downloadable software on sauermanngroup.com KILOG Lite software allows to configure the data logger, to view data and to save data in PDF file.



Configuration and data processing software KILOG software allows you to configure, save and process your data in a very simple way.

- · Software only: ref. KILOG-3-N
- Complete set: software + 1 interface. Ref. KIC3-N

#### USB-micro USB cable: CK50

This cable allows you to connect your KISTOCK to your PC.

#### Accessories

- 2 CR2032 batteries pack. Ref. P2-50
- Data collector: collects up to 20 000 000 points from one or several KISTOCK directly on-site. Results restitution on PC of realised datasets. Ref: KNT-320



Only the accessories supplied with the device must be used.

**Maintenance:** please avoid any aggressive solvent. Please protect the device from any cleaning product containing formalin, that may be used for cleaning rooms or ducts.

# Mounting

KISTOCK can be mounted in different ways, you can also move it or install it very easily.

- Magnetic mounting (see photo)
- Necklace for anti-theft
- 2. Batteries cover 3. Magnetic fixing
- 4. Locking sign of the batteries cover

#### Replace the batteries

500 days\* battery life, KISTOCK ensure long-term measurements. To change the batteries:

- Unlock the battery cover with a screwdriver or a coin.
- Put the 2 batteries superimposing them (3 V CR2032 button batteries) with the + pole visible.
- Put back the batteries cover: the sign of the batteries cover must be placed in front of the opened padlock.
- Turn right the batteries cover: the sign on the batteries cover must be placed in front of the closed padlock.
- \*For a KT 50. Non-contractual value. Based on 1 measurement each 15 minutes at 25 °C. A correct operation of the device and the storage conditions must be respected.

**Precautions for use:** please always use the device in accordance with its intended use and within parameters described in the technical features in order not to compromise the protection ensured by the device.



CAUTION! Material damages can occur, apply the indicated precautionary measures.

